


DROP IN ANCHOR, EDA and EDA-K


Mounting




1. Drill the hole, according to the tabel below.

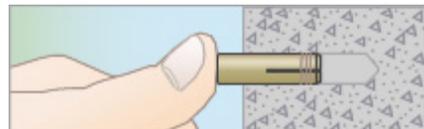

2. Blow the hole clean and push in the drop-in anchor. For EDA-K the drilling depth is extended by 15 mm to avoid blowing clean

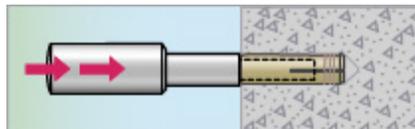

3. Knock down the wedge using the ESSVE punch until mandrel collar is level with the drop-in anchor.

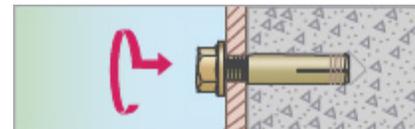

4. Screw on the detail using an appropriate bolt. Installation is complete.

Installation Torque

Dimension	Installation Torque Nm
M8	8
M10	15
M12	35
M16	60

Technical information

Dimension	Drill Ø mm	Drill depth mm	Mounting depth mm	Screwing depth Min/Max mm
M8	10	35	30	8-14
M10	12	45	40	10-15
M12	15	55	50	12-20
M16	20	75	65	16-25